






Installation Instructions

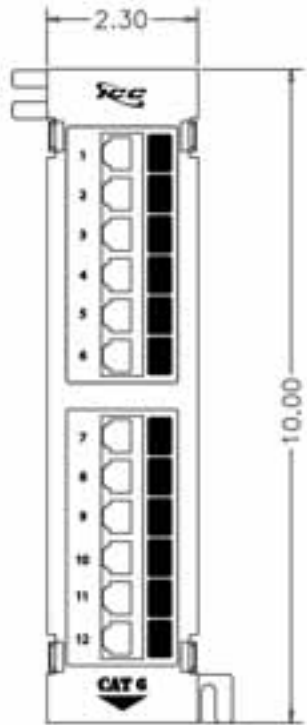

Front View

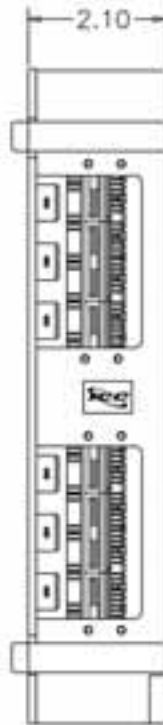


Side View

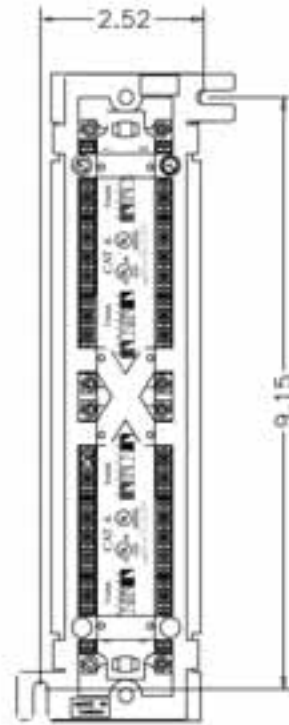

Back View

T568A/T568B Color Code Insert (Included)

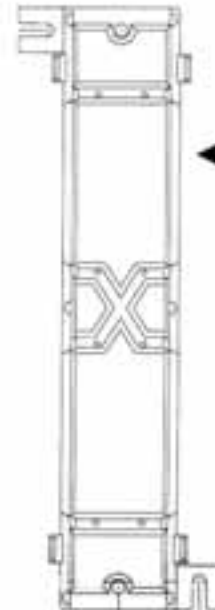


CAT 6

| ITEM NO | NO. OF PORTS |
|------------|--------------|
| ICMPP12V60 | 12 |


Installation Instructions page 2

| Hardware Included | Quantity |
|--------------------------------|--------------|
| Mounting Bracket | 1 per panel |
| 6" Cable Ties | 3 per panel |
| T568A/T568B Color Coded Insert | 1 per panel |
| CAT 6 Termination Caps | 24 per panel |

 IC110 Punch-Down Tool
Item# ICACSPDT00
For terminating conductors
(sold separately)



Cable Tie Holder
0.135" x 6" Cable Ties
(included) for Cable
Management

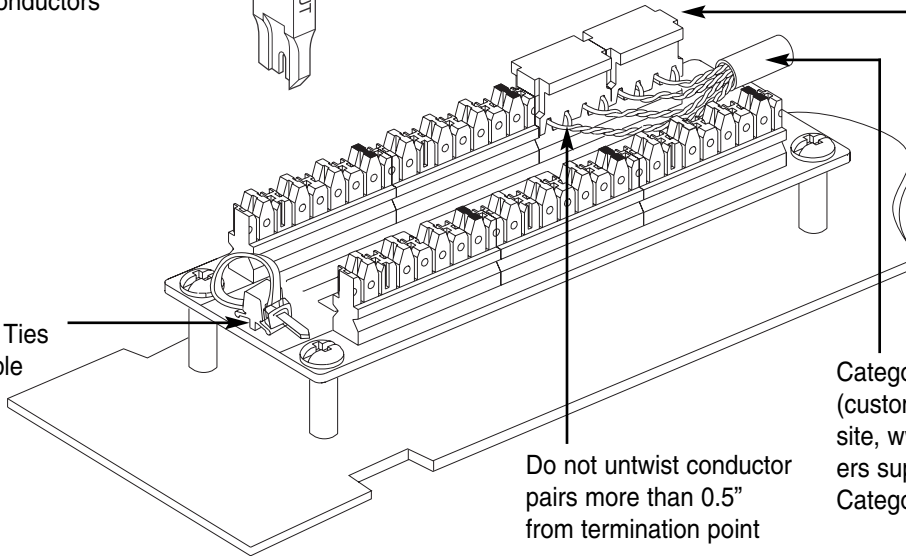


Termination Cap Supplied
One cap terminates four
conductors.

Category 6 Cable
(customer supplied, call or visit ICC web
site, www.icc.com, for listing of manufactur-
ers supplying cable compatible with ICC's
Category 6 channel solution)


Do not untwist conductor
pairs more than 0.5"
from termination point

Figure 1.
T568B Wiring Diagram

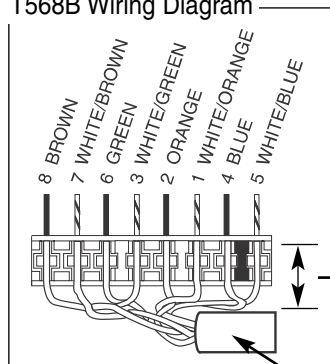

0.5" max. untwist - this is critical
for performance

Figure 2.
T568A Wiring Diagram

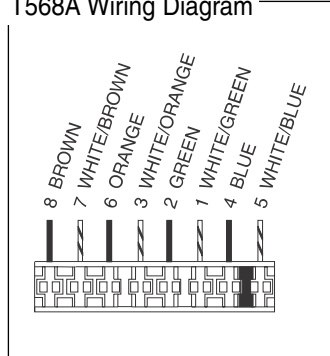

Maintain Cable Sheath as close
to termination point as possible.

Instructions:

Unpack patch panel and place the panel with the 110 type connectors exposed. Orient the panel with the blue colored 110 connector in the upper right hand corner. Proceed to the Installation Practices.

Installation Practices

- 1) When preparing the cable for termination, maintain the cable sheath as close to the termination point as possible.
- 2) Use the cable tie anchors provided to secure and route cables.
- 3) When securing cables, maintain minimum bend radius of four times the cable diameter and do not overtighten cable ties.
- 4) **IMPORTANT: Press the conductors firmly into the proper 110 channel according to the color coded label, maintaining less than 0.5" of untwist.(See Figure 1 & 2)**
- 5) Set punch-down tool to low impact setting.
- 6) Align punch-down tool directly over conductor to be terminated, perpendicular to the 110 channel, with cutting blade in proper orientation.
- 7) Push down to terminate and trim conductors.
- 8) Proceed to the next conductor to be terminated.
- 9) **IMPORTANT: Install termination caps supplied, after cables are terminated, and before testing.**
- 10) Upon completing, Snap on bracket & proceed to mount on wall.